

**Chemung County Stormwater
Construction Inspection
Erosion and Sediment Control**



Project Name Villa's at Gardner Road	Date 9-24-20
Location Lynhurst Ave Horseheads, NY	Permit # NYR11A108
Weather Conditions sunny	Entry Time: 12:06 pm
On-Site Representative Present: Jim Clark	Exit Time: 12:37 pm

Construction Site Notes:

	-Work continues to progress on the two single family homes. There is no earth grading activities at this time.
	-Erosion and sediment control practices have not been maintained in months.
	-Silt fence along south end of property can be removed. There is no active construction, it isn't being maintained anyways, and the vegetation is 80% that is tributary to it. Remove or Repair but something needs to be done.

Yes	No	N/A	
	X		All erosion and sediment control measures installed/constructed
	XX		All erosion and sediment control measures maintained properly
	X		Are there currently more than 5 acres disturbed w/o prior approval
X	X		Have stabilization measures been initiated in inactive areas
X			Are permanent stormwater control measures being implemented
			Was there a discharge into the receiving water on the day of inspection
			Evidence of turbidity or oil in the receiving waters
X			Are weekly inspections being performed?
X			Are the inspections being performed by a qualified individual?

Corrections Needed:

-Silt fence requires maintenance around the lots that are open.
-Stabilization of bare soil is required. ESPECIALLY the slopes behind the homes under construction. This had an erosion control blanket but perennial vegetation did not establish under it, the blanket biodegraded, and now the slope is eroding.
-Concrete washed out onto the ground.

Satisfactory	Marginal	Unsatisfactory XX
Date <i>9/24/20</i>	Inspector <i>Jessica Verigin</i>	



COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14845
Ph. 607.796.2216

PROJECT: Villa's at Gardner Road
Village of Elmira Heights
MS4 Construction Inspection
September 24, 2020

BY: Jessica Verrigni, CPESC, CPSWQ



No E&S controls are being maintained.



This line of silt fence can be removed. Grass is 80% vegetated and there is no active construction. Will need to be reinstalled on individual lots when built.



Stabilization required in areas of bare soil.



Erosion control blanket has disintegrated and no perennial vegetation established. Major erosion is occurring.