

**Chemung County Stormwater
Construction Inspection
Erosion and Sediment Control**



Project Name LECOM	Date 8-7-2019
Location Park Place, City of Elmira	Permit # NYR11E617
Weather Conditions overcast, humid	Entry Time: 9:26 am
On-Site Representative Present: None	Exit Time: 9:35 am

Construction Site Notes:			
			-No earthwork is being conducted at this time. Work on the building is the only thing occurring.

Yes	No	N/A		
x			All erosion and sediment control measures installed/constructed	
	x		All erosion and sediment control measures maintained properly	Drop Inlet
	x		Are there currently more than 5 acres disturbed w/o prior approval	
		x	Have stabilization measures been initiated in inactive areas	
x			Are permanent stormwater control measures being implemented	
	x		Was there a discharge into the receiving water on the day of inspection	
	x		Evidence of turbidity or oil in the receiving waters	
x			Are weekly inspections being performed?	monthly
x			Are the inspections being performed by a qualified individual?	

Corrections Needed:			
-C2 catch basin- The drop inlet protection is not installed correctly. There is also an insert being utilized under the cover that requires maintenance. A lot of sediment has accumulated in it.			
-There is sediment from the project up and down both W. Fourth Street and Clinton Street. These streets need to be swept. It is not the City's responsibility to clean the sediment off the road from the project.			
-Concrete washout is brand new but there are areas where it is still washed onto the ground.			

Satisfactory	Marginal	Unsatisfactory	x*
Date 8/7/19	Inspector <i>Justina Verrugni</i>		

**Unsatisfactory given because repairs have not been made from the municipal inspection on 6/24/19.*



COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14825
Ph. 607.796.2216

PROJECT: LECOM
City of Elmira
Municipal Inspection
August 7, 2019

BY: Jessica Verrigni, CPESC, CPSWQ



Correction made to traffic entering/exiting through this area.



Sediment from the project is up and down W Fourth Street and Clinton Street. It needs to be cleaned up.



Drop inlet protection is still not repaired and now there is sediment building up on the insert inside the catch basin.



Concrete washed next to the building even though there is a functioning concrete washout.