

**Chemung County Stormwater
Construction Inspection
Erosion and Sediment Control**



Project Name LECOM expanded parking lot	Date 3-18-2020
Location Park Ave, Elmira (city), NY	Permit # NYR11E617
Weather Conditions sunny	Entry Time: 10:56 am
On-Site Representative Present: None	Exit Time: 11:02 am

Construction Site Notes:			
			-Fence being installed along perimeter of parking area.
			-No other work is occurring at this time.

Yes	No	N/A		
		X	All erosion and sediment control measures installed/constructed	
		X	All erosion and sediment control measures maintained properly	
	X		Are there currently more than 5 acres disturbed w/o prior approval	
X	X		Have stabilization measures been initiated in inactive areas	SEE NOTE
X			Are permanent stormwater control measures being implemented	
	X		Was there a discharge into the receiving water on the day of inspection	
	X		Evidence of turbidity or oil in the receiving waters	
			Are weekly inspections being performed?	
			Are the inspections being performed by a qualified individual?	

Corrections Needed:			
-All soil for the project was either covered with straw or rolled erosion control blanket in December. Seeding was not completed. Rolled erosion control blanket was not installed correctly because it is not anchored to the soil.			
It has blown off site, is not protecting the soil and needs to be re-installed.			
-There is still swales, landscaping and other items that need to be completed as part of the SWPPP before this area would be complete and usable.			

Satisfactory	Marginal	X	Unsatisfactory
Date 3-18-2020	Inspector <i>Jessica Verrigni</i>		



COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14825
Ph. 607.796.2216

PROJECT:	LECOM expanded parking
	City of Elmira
	Municipal Inspection
	March 18, 2020

BY:	Jessica Verrigni, CPESC, CPSWQ
------------	--------------------------------



Rolled erosion control blanket has blown off the area that it was supposed to be protecting.



Rolled erosion control blanket was not secured properly to the soil and now has blown back. Soil is exposed and unprotected.



Rolled erosion control blanket was not secured properly. This photo shows a whole section blown across the street into a neighbors yard.



Soil is not stabilized or protected from erosion.