

**Chemung County Stormwater
Construction Inspection
Erosion and Sediment Control**



Project Name Barrington West Lot 83& 84	Date 8/13/2021
Location Wexford Court Horseheads, NY	Permit # NYR11F212
Weather Conditions sunny, warm	Entry Time: 10:10 am
On-Site Representative Present: none	Exit Time: 10:17 am

Construction Site Notes:	
	-Home is currently under construction.

Yes	No	N/A	
X			All erosion and sediment control measures installed/constructed
	X		All erosion and sediment control measures maintained properly
	X		Are there currently more than 5 acres disturbed w/o prior approval
	X		Have stabilization measures been initiated in inactive areas
		X	Are permanent stormwater control measures being implemented
	X		Was there a discharge into the receiving water on the day of inspection
	X		Evidence of turbidity or oil in the receiving waters
X			Are weekly inspections being performed?
X			Are the inspections being performed by a qualified individual?

Corrections Needed:
-Silt fence around the entire site needs to be replaced. Many areas the silt fence is knocked over and buried under sediment.
-Soil Stabilization- Soil has not been stabilized and there is erosion occurring all over the property. This is the cause of the sediment going over the silt fence. Stabilization is required immediately.
-Driveway culvert pipe is clogged with stone and debris. This impedes roadside drainage. Clean out.

Satisfactory	Marginal	Unsatisfactory	X
Date 8/13/21	Inspector <i>Jessica Verrigni</i>		



COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14845
Ph. 607.796.2216

PROJECT: Barrington West Lot 83 & 84
Town of Horseheads
Municipal Construction Inspection
August 13, 2021

BY: Jessica Verrigni, CPESC, CPSWQ



Silt fence around the entire property needs to be replaced. Sediment has overtopped it in a number of locations.



Silt fence around the entire property needs to be replaced. Sediment has overtopped it in a number of locations.



Major erosion is occurring on soils that have been left unprotected for so long.



Driveway pipe is clogged with stone and debris. Water flow is impeded.