

**Chemung County Stormwater
Construction Inspection
Erosion and Sediment Control**



Project Name LECOM	Date 3-21-2019
Location College Ave.- Elmira (City)	Permit # NYR11E617
Weather Conditions Cool, overcast	Entry Time: 8:03 am
On-Site Representative Present: Norm- Edger Jeff- Edger	Exit Time: 8:23 am

Construction Site Notes:

-Working on installing underground chambers and water quality unit.
-Working on pouring foundation walls.

Yes	No	N/A	
<input checked="" type="checkbox"/>			All erosion and sediment control measures installed/constructed
	<input checked="" type="checkbox"/>		All erosion and sediment control measures maintained properly
	<input checked="" type="checkbox"/>		Are there currently more than 5 acres disturbed w/o prior approval
	<input checked="" type="checkbox"/>		Have stabilization measures been initiated in inactive areas
<input checked="" type="checkbox"/>			Are permanent stormwater control measures being implemented
	<input checked="" type="checkbox"/>		Was there a discharge into the receiving water on the day of inspection
	<input checked="" type="checkbox"/>		Evidence of turbidity or oil in the receiving waters
<input checked="" type="checkbox"/>			Are weekly inspections being performed?
<input checked="" type="checkbox"/>			Are the inspections being performed by a qualified individual?

Corrections Needed:

-Silt fence along Cinton Street needs splice repaired. This was being done while I was still on site.

-Concrete was being washed onto the ground along Clinton Street.

-Construction entrance on 4th street needs maintenance. It is silted in.

Satisfactory

Marginal

Unsatisfactory

Date 3-21-19	Inspector <i>Juan Verrigni</i>
---------------------	---------------------------------------



COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14825
Ph. 607.796.2216

PROJECT:	LECOM
	City of Elmira
	Municipal Inspection
	March 21, 2019
BY:	Jessica Verrigni, CPESC, CPSWQ



Construction entrance requires maintenance.



Concrete washout.



Concrete washed out onto the ground when there is a washout area provided on site.



Silt fence splice needs repair (this was being repaired while I was still on site).



COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14825
Ph. 607.796.2216

PROJECT:	LECOM
	City of Elmira
	Municipal Inspection
	March 21, 2019
BY:	Jessica Verrigni, CPESC, CPSWQ



Concrete blankets piled on top of the silt fence.



Underground stormwater chambers.



Underground stormwater chambers (north end).
Observation port installed in isolation row.



Stormwater water quality units.





COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14825
Ph. 607.796.2216

PROJECT:	LECOM
	City of Elmira
	Municipal Inspection
	March 22, 2019
BY:	Jessica Verrigni, CPESC, CPSWQ



Remainder of stormwater chambers with observation ports have been installed.

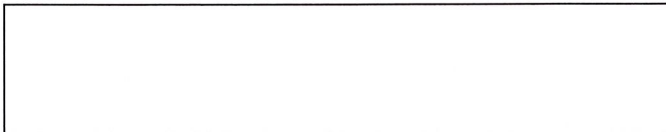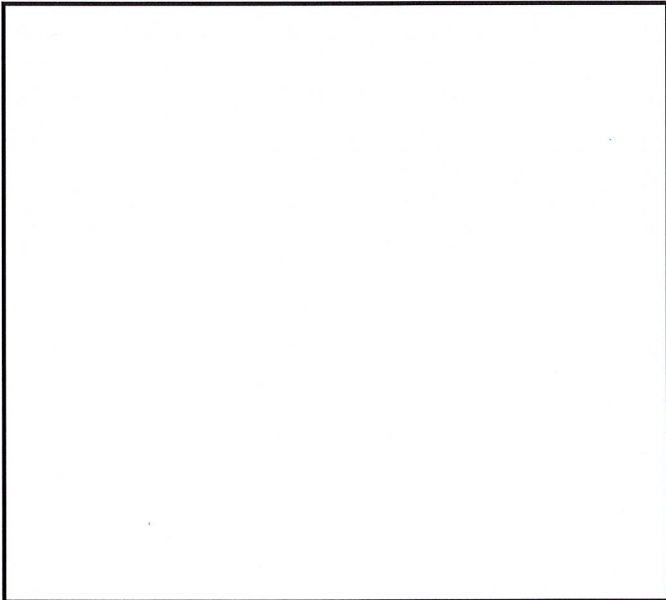

Installing infrastructure to underground system.

