

**Chemung County Stormwater
Construction Inspection
Erosion and Sediment Control**



Project Name CDS Monarch Senior Living Facility	Date 6-26-18
Location Maple Ave. City of Elmira	Permit # NYR11C547
Weather Conditions Sunny, warm	Entry Time: 10:10
On-Site Representative Present: Jeff & Justin Bellinger, Christa	Exit Time: 10:28

Construction Site Notes:

-No earthwork is occurring at this time. Most work is being done inside of the building.

Yes	No	N/A	
X			All erosion and sediment control measures installed/constructed
	X		All erosion and sediment control measures maintained properly
		X	Are there currently more than 5 acres disturbed w/o prior approval
X			Have stabilization measures been initiated in inactive areas
X			Are permanent stormwater control measures being implemented
	X		Was there a discharge into the receiving water on the day of inspection
	X		Evidence of turbidity or oil in the receiving waters
X			Are weekly inspections being performed?
X			Are the inspections being performed by a qualified individual?


Corrections Needed:

-Water is getting under the compost sock. Rock has been used to plug the eroded area but water is still causing issues.

-Silt fence at rear entrance has been overwhelmed by sediment and water. The water has undercut the silt fence. Replacement is required.

-Compost sock at the rear of the building is 100% filled with sediment and requires maintenance.


Satisfactory	Marginal	X	Unsatisfactory
Date 6-26-18	Inspector <i>Jason Verigin</i>		

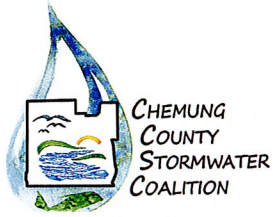

COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14825
Ph. 607.796.2216

PROJECT: CDS Monarch Senior Living
City of Elmira
Municipal Construction Inspection
June 26, 2018

BY: Jessica Verrigni, CPESC, CPSWQ

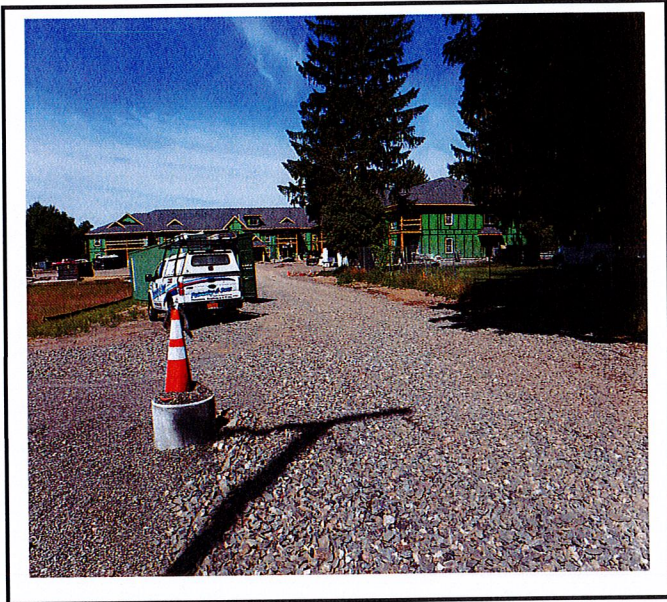

Construction entrance is in good shape.



Water is getting under compost sock. Rock has been placed in eroded area but water is still cutting around it.



Infiltration basin has good grass cover.



Silt fence at rear entrance point has been overwhelmed by sediment and water. Water has undermined the fence. Fence needs replacement.



COUNTY OF CHEMUNG
Chemung County Stormwater Coalition
851 Chemung Street
Horseheads, New York 14825
Ph. 607.796.2216

PROJECT: CDS Monarch Senior Living
City of Elmira
Municipal Construction Inspection
June 26, 2018

BY: Jessica Verrigni, CPESC, CPSWQ



Compost sock at the rear of the building is over capacity and needs replacement or silt needs to be removed .

