

**Chemung County Stormwater  
Construction Inspection  
Erosion and Sediment Control**



<b>Project Name</b> Barrington West Lot 85	<b>Date</b> 10-29-19
<b>Location</b> Wexford Court Horseheads (T), NY	<b>Permit #</b> NYR11F212
<b>Weather Conditions</b> overcast, cool	<b>Entry Time:</b> 10:15 am
<b>On-Site Representative Present:</b> Brad Kapral, Contractor/Lot owner	<b>Exit Time:</b> 10:45 am

Construction Site Notes:	
	-Lot 85 home is under construction.
	-Construction crew was actively addressing erosion and sediment control concerns at time of inspection.
	<ul style="list-style-type: none"> <li>• New silt fence installed</li> <li>• New construction entrance installed</li> <li>• All bare soil seeded and mulched with straw</li> </ul>

Yes	No	N/A		
X			All erosion and sediment control measures installed/constructed	
X			All erosion and sediment control measures maintained properly	
	X		Are there currently more than 5 acres disturbed w/o prior approval	
X			Have stabilization measures been initiated in inactive areas	
		X	Are permanent stormwater control measures being implemented	
	X		Was there a discharge into the receiving water on the day of inspection	
X			Evidence of turbidity or oil in the receiving waters	See note
X			Are weekly inspections being performed?	
X			Are the inspections being performed by a qualified individual?	

Corrections Needed:	
	-Sediment on the road needs to be removed. <i>Contractor was removing by the end of inspection.</i>
	-Concrete washout will need to be installed before driveway is poured.
	-Qualified Inspections- Contractor needs to review reports from the qualified inspector and make corrections as they are documented.
	-Contractor does not have 4 Hour Erosion and Sediment Control Training.
	-Turbidity has been discharged through storm drainage onto neighboring property. Properly used and maintained erosion and sediment control practices should prevent this from happening.

Satisfactory	Marginal	X	Unsatisfactory
<b>Date</b> 10/29/19	<b>Inspector</b> <i>Jessica Verrigni</i>		




**COUNTY OF CHEMUNG**  
**Chemung County Stormwater Coalition**  
 851 Chemung Street  
 Horseheads, New York 14825  
 Ph. 607.796.2216

**PROJECT:** Barrington West Lot 85  
 Town of Horseheads  
 Municipal Inspection  
 October 29, 2019

**BY:** Jessica Verrigni, CPESC, CPSWQ



Contractor debris and trash has been picked up, temporary seed and mulch placed, and silt fence replaced or fixed around entire site.

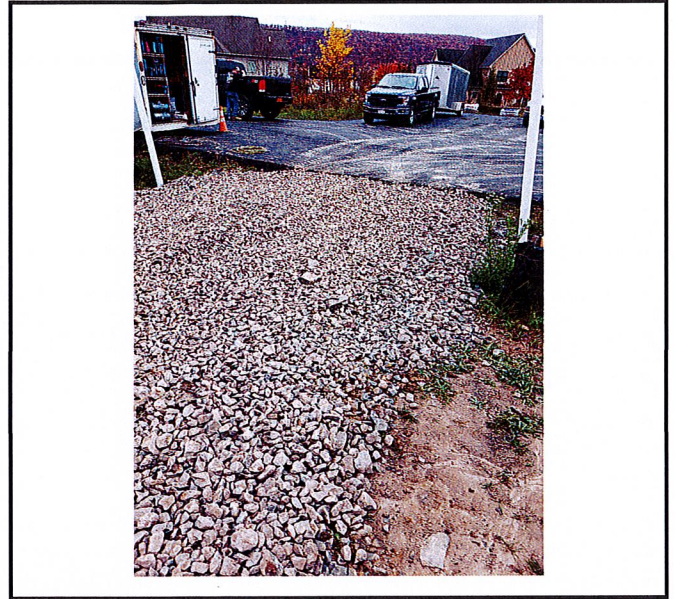

Construction Entrance has been replaced. Contractor will remove sediment tracking from the road.



Contractor debris and trash has been picked up, temporary seed and mulch placed, and silt fence replaced or fixed around entire site.



Contractor debris and trash has been picked up, temporary seed and mulch placed, and silt fence replaced or fixed around entire site.